

# RXV Receiver Hitch Evaluation

Part number 20431

Receiver came with no instructions, only a template and a warning. 7/8" hole really needs to be 1" to allow for washer and wrench clearance and room for error (figure 1 and 2). The bottom bolt fastened to the bag well had to be removed and the other bolt loosened to allow the plastic bumper to flex. However, the material is rigid and doesn't give very much. I had to use a floor jack and force the receiver in between the plastic and frame while prying on the plastic. It was an extremely tight fit.



figure 1

Receiver came with two bolts, flat washers, and lock washers although I didn't use either of the washers because the bolts wouldn't be long enough. Bolts are M10-1.5x20. They need to be 25mm.



figure 2



*Product Development Team  
Buggies Unlimited/Nivel*